


# CX-76

Colbaix®

## FIBERCOLLE GEL

Ready-to-use lightweight vinyl glue for decorative fibreglass. High performance.

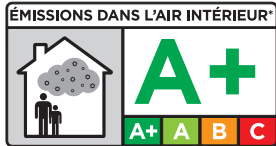

\* information représentative des émissions dans l'air intérieur des substances volatiles présentant un risque de toxicité par inhalation, sur une échelle de classe allant de C (fortes émissions) à A+ (très faibles émissions).

INTERIOR



INFORMATION ABOUT DIRECTIVE 2004/42/CE

This product contains max. < 5 g/l VOC

### SURFACES

Plaster, plaster of Paris, plasterboard and general absorbent surfaces or those painted with traditional class 1, 2 and/or 3 paints.

Surfaces must be sound, dry, cohesive, absorbent, well adhered, clean and free of dust.

### CHARACTERISTICS

- Creamy appearance.
- Excellent brushability.
- Quick and easy pasting.
- Does not splatter.
- High quality.
- Good initial sticking.
- Odourless product.
- High performance.
- Excellent adhesion
- Colourless once dry.
- Excellent tack.

### IDEAL FOR

- Gluing vinyl wall coverings with paper or textile.
- Sticking lightweight and vinyl papers and fibreglass.

### ON-SITE APPLICATION

#### SURFACE PREPARATION

The surface must be sound, clean and free of any trace of saltpetre, fungi, microorganisms, grease, release oils and, in general, any type of material that could make it difficult for the product to adhere to the surface.



CX-76

Colbaix®

## FIBERCOLLE GEL

### ON-SITE APPLICATION

#### CLEANING

When the supports present traces of fungi, algae or other types of microorganisms, we will proceed with the curative treatment, first of all, with a quick mold cleaner. This will be applied to the surface to be treated and after 5 -10 minutes of action, the support will be cleaned with the help of a pressurized water machine or with a hard bristle brush. Next, and once the support is completely dry, a broad-spectrum biocide cleaner will be applied until the support is completely impregnated. This treatment is called preventive, it is very effective and serves to prevent the future appearance of microorganisms.

If there are saltpetre stains on the surface to be treated, carry out an initial cleaning process with our **RX-523 CLEAN SAL**, applying the material and then scraping it with a hard bristle brush. After mechanically cleaning the surface, it will need to be rinsed with plenty of clean water in order to neutralise any **CLEAN SAL** residue that may remain on the surface.

Any grease or oil must be completely eliminated to allow the product to adhere correctly to the surface. Therefore, we recommend using **RX-527 CLEAN OIL** for correct and total elimination of these substances.

Powdery surfaces must be consolidated with a fixative (**FIJAPREN** line), since dust prevents adhesion between materials. Similarly, old surfaces made up of perished plaster or poorly adhered parts must be cleaned up: **restoring perished surfaces without prior restoration is totally inadvisable**. If there are holes in the surface, these should be scraped down and removed until a consistent surface is created, then a fixative (**FIXAPREN** line) should be applied to remove traces of dust. This consistent surface will usually be made of brick, cement, functional plaster or any other material, as long as it can support the weight and tension of the layers subsequently applied, without breaking up or having its structure altered.

If cracks are present these must be repaired, i.e. opened up and their interiors fixed using a fixative (**FIJAPREN** line), left to dry for at least 4 hours and then filled to the required level.

#### DIRECTIONS FOR USE

Ready-to-use.

Can be applied with a brush and/or roller.

Wipe off residue with a damp cloth before it dries, as well as the working tool with water immediately after use.

On surfaces primed or coated with class 1, 2 or 3 paints, wait at least 48 hours, under normal conditions, before applying the fibreglass or wallpaper.

CX-76

Colbaix®

# FIBERCOLLE GEL

## TECHNICAL CHARACTERISTICS

Base	Vinyl	Open time	Aprox. 30'
Content of solids	15 - 20 % by weight	Full drying	24 H aprox.
Density	1,05 ± 0,07 g/ml	pH	5.5 - 7.5
Brookfield viscosity	45000 - 68000 cP. (A/6/10)	Tool cleaning	With water

### PERFORMANCE

grams applied per m<sup>2</sup>

250 - 350

(\* ) Depending on the coating, the instructions for use and the tool used for application.

## INFORMATION OF INTEREST

The manufacturing process is controlled in batches, which allows traceability of any incident. The quality system used includes each article's design and production controls, both in terms of the raw materials used, guaranteeing uniform manufacturing, and the final item obtained. The use of ecotechnologies in our facilities' manufacturing processes allows for efficient work, without damaging the environment that surrounds us.

- Non-flammable product.
- Avoid the product coming into contact with skin and eyes.
- Smoking, eating and drinking must be prohibited in the application area.
- Comply with legislation on health and safety at work.
- Keep the product in a dry place, in original containers that are kept properly closed.
- Store the containers between 5°C and 35°C.
- Recommended storage time: 12 months from the date of manufacture in its original packaging and protected from moisture.

For further information on protective measures and first aid, please refer to the product's Safety Data Sheet.

CX-76

Colbaix®

## FIBERCOLLE GEL

### COMMENTS

- For appropriate use and correct application of the product, it is essential to first read the technical data sheet.
- The data provided in this data sheet are for guidance only and should not be considered binding. The data has been obtained in normal laboratory conditions and on standardised surfaces, and can vary depending on the conditions in which they are applied (absorption of the surface, applied thickness, temperature, environmental humidity, etc.). The intervals displayed have been shaped by measurement history. Slight deviations from the ranges presented in this technical sheet, whether higher or lower, will be accepted according to internal technical criteria and will not result in a loss of quality or affect the performance of the final product, due, among other factors, to variations in measurement conditions and the uncertainty associated with the instruments used.
- The working conditions of the users are beyond our control.
- The product must not be used for purposes other than those specified. It is recommended that the recommendations for use be strictly followed.
- It is essential that the status of the surfaces be assessed prior to each application.
- Do not apply on surfaces whose temperature is less than 5°C or excessively hot.
- Do not mix with any material, as it will not retain its technical characteristics.
- Application temperature: from 5°C to 35°C.
- Application on old paint that is poorly adhered to the surface, or on a non-washable surface can cause the coating to come off at the weakest point.

### SPECIAL REMARKS FOR USING WALL COVERINGS

- Do not dilute under any circumstances. Stir gently if deemed appropriate.
- Do not apply the **FIBERCOLLE GEL** adhesive until the applicable primer is completely dry (no tackiness or stickiness to the touch). We recommend water-based primers as a pre-treatment. Solvent-based primers may cause a considerable delay in the drying of the adhesive.
- For the correct adhesion and durability of the surface-coating gluing, we recommend applying a minimum of 250 to 400 grams of **FIBERCOLLE GEL** per square metre of surface. Smaller quantities may cause adhesion and system cohesion failure. Each type of coating requires a minimum amount of glue, depending on its need or texture.
- The application of the **FIBERCOLLE GEL** adhesive on totally blocked surfaces (non-absorbent) will considerably delay the drying process. In these cases, waiting time before painting will be prolonged in time (experimentally, it has been estimated that the drying time will be delayed by 24 to 48 hours, which will vary according to the environmental temperature and humidity conditions).

# CX-76

Colbaix®

## FIBERCOLLE GEL

### SPECIAL REMARKS FOR USING WALL COVERINGS

- During the drying process of the adhesives/glues, on solvent based surfaces, a deformation of some coatings can be observed (blistering, swelling of the back of the coating...), this is due to the nature of the special coating itself, and not to the nature of the glue. When the adhesive drying process is complete, the adhesive recovers its initial shape and spread. As this is happening, we recommend ventilating the room and/or providing hot forced air circulation. The drying process will be successfully completed within 48 hours.
- We strongly advise against painting the coatings without the adhesive having dried completely. Pre-checking is essential. Failure to comply with this observation may result in the **total** removal of the coating.
- Failure to observe these essential steps for the proper execution and completion of the work is beyond our control and will be the sole responsibility of the professional applicator.

### PACKAGING

FORMAT	17 kg.	4 kg.
UNIT/BOX	-	-
PALLETS	33 CANS	120 CANS



Internal code	CX76NF2791A23
---------------	---------------